

# SCA610 Series

### Accelerometer Chip

#### FEATURES

- Available ranges ±0.5g, ±1g, ±1.5g, ±1.7g
  8-pin plastic surface mount DIP package
- mountable with pick and place machinesEnhanced failure detection
- Digitally activated electrostatic self test (not for inclinometers)
- Calibration memory parity check
- Continuous connection failure detection
- Bi-directional acceleration measurement
- Controlled frequency response in the sensing element
- Re-flow solder, process compatible
- Single +5V supply; ratiometric voltage output in the range 4.75 ... 5.25V

### BENEFITS

- Exceptional reliability, unprecedented accuracy and excellent stability over temperature and time
- Outstanding overload and shock durability
- No additional components required


#### APPLICATIONS

- Acceleration measurement
- Inclination measurement
- Motion measurement
- Vibration measurement

## For customised products please contact VTI HAMLIN


### DIMENSIONS

The accelerometer weighs under 1g. The size of the part is approximately (w x h x l) 9 x 5 x 11 mm. Pin pitch is standard 100 mils.

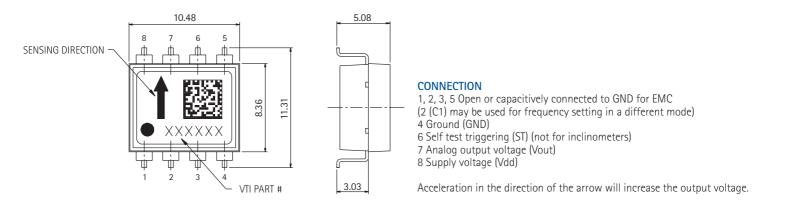

### PCB PAD LAYOUTS

### PRODUCT CODE KEY

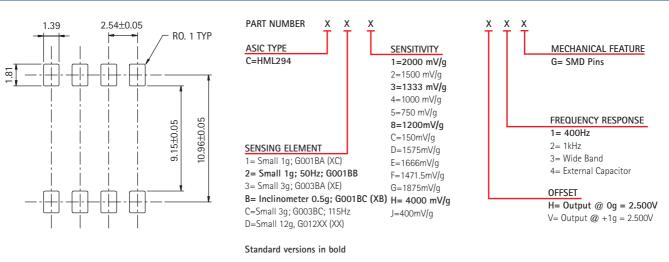



### SCA610 Series

Parameter         Value         Units           Acceleration (powered or non-powered)         20000         g           Supply voltage         -0.3 to +7.0         V           Voltage at input / output pins         -0.3 to Vdd + 0.3         V           Temperature range         -55 to +125         °C	ABSOLUTE MAXIMUM RATINGS		
Supply voltage-0.3 to +7.0VVoltage at input / output pins-0.3 to Vdd + 0.3V	Parameter	Value	Units
Voltage at input / output pins -0.3 to Vdd + 0.3 V	Acceleration (powered or non-powered)	20000	g
	Supply voltage	-0.3 to +7.0	V
Temperature range -55 to +125 °C	Voltage at input / output pins	-0.3 to Vdd + 0.3	V
	Temperature range	-55 to +125	°C

Parameter	Condition	Min.	Тур	Max.	Units
Supply voltage Vdd		4.75		5.25	V
Current consumption	Vdd = 5V; No load		2.0	4.0	mA
Operating temperature		- 40		+ 125	°C
Resistive output load	Vout to Vdd or Vss	20			kOhm
Capacitive load	Vout to Vdd or Vss			20	nF
Output noise <sup>(9</sup>	DC4kHz		1	5	mVrms

Parameter	Condition/ Comment	SCA610- CBHH1G <sup>(11</sup>	SCA610- CB1H1G <sup>(11</sup>	SCA610- C23H1G	SCA610- C28H1G	Units
Measuring range <sup>(1</sup>	Nominal	±0.5	±1	±1.5	±1.7	g
Mounting plane (2	Measuring Direction	Horizontal	Horizontal	Horizontal	Horizontal	-
Zero point (nom.) <sup>(3</sup>	Mounting position	Vdd/2	Vdd/2	Vdd/2	Vdd/2	V
Sensitivity	@ room temperature	4 <sup>(5b</sup>	2 <sup>(5a</sup>	1.333 <sup>(5a</sup>	1.2 <sup>(5a</sup>	V/g
Zero point error	-40125°C	$\pm 60^{(4)}$	$\pm 60^{(4)}$	±125 <sup>(4</sup>	±125 <sup>(4</sup>	mg
Sensitivity error	-40125°C	±4 <sup>(6b</sup>	±4 <sup>(6a</sup>	±4 <sup>(6a</sup>	±4 <sup>(6a</sup>	0/0
Typical non-linearity <sup>(6</sup>	Over measuring range	±10 <sup>(7b, c</sup>	±20 <sup>(7a, c</sup>	±30 <sup>(7a</sup>	±40 <sup>(7a</sup>	mg
Cross-axis sensitivity (8		5	5	5	5	0/0
Frequency response	-3dB point <sup>(9</sup>	6±4	6±4	50±30	50±30	Hz
Ratiometric error (10	Vdd = 4.755.25V	2	2	2	2	0/0

Note 1. The measuring range is limited by sensitivity, offset and supply voltage rails of the device.

Note 2. Measuring direction parallel to mounting plane.

Note 3. Vertical versions in +1g position, i.e. arrow up; horizontal versions pins down (+0g).

Note 4. Zero point error specified as (Vout (+0g) - Vdd/2) / Vsens [g] (room temp. error included); Vsens = Nominal sensitivity.

Note 5a. Sensitivity specified as [Vout (+1g) - Vout(-1g)] / 2 [V/g].

Note 5b. Sensitivity specified as [Vout (+0.5g) - Vout(-0.5g)][V/g].

Note 6a. Sensitivity error specified as {[Vout (+1g) -Vout (-1g)] / 2 -Vsens} / Vsens x 100% [%] (room temp. error included); Vsens = Nominal sensitivity.

Note 6b. Sensitivity error specified as {[Vout (+0.5g) -Vout (-0.5g)] -Vsens} / Vsens x 100% [%] (room temp. error included); Vsens = Nominal sensitivity.

Note 7a. Relative to straight line between  $\pm 1g$ .

Note 7b. Relative to straight line between ±0.5g.

Note 7c. In inclinometer applications a correction based on the angular error resulting in cross-axis sensitivity around the inclination angle reduces non-linearity.

Note 8. The cross-axis sensitivity determines how much acceleration, perpendicular to the measuring axis, couples to the output. The total cross-axis sensitivity is the geometric sum of the sensitivities of the two axes, which are perpendicular to the measuring axis.

F 001/)

Note 9. The output has true DC (OHz) response.

Note 10. Supply voltage noise also couples to the output, due to the ratiometric (output proportional to supply voltage) nature of the accelerometer.

Note 11. Self test not recommended

The ratiometric error is specified as:

$$RE = 100\% \times \left( 1 - \frac{Vout(@Vx) \times \frac{5.00V}{Vx}}{Vout(@5V)} \right)$$

